

Work Order ID 72844

Tuesday, August 16, 2011 10:45:46 AM

Page 1

Item ID: D407-667-105

Accept

Setup Start

Revision ID:

Stop

Item Name: Crosstube Fwd

Start Date: 8/16/2011 Start Qty: 1.00

Cust Item ID:

Required Date: 8/16/2011 Req'd Qty: 1.00

Customer:

Reference: REWORK From hang Keng

Approvals: Process Plan: MF Date: 11-08-16 Tooling:

Run Start

QC: Date: SPC (Y/N):

Stop

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
D407-667-145	Rev C (DEO)
DSI9565	A

290

0.00



Packaging

Memo

0.00

Packaging

PULL FROM STOCK D407-667-105 X 1 B 38989

IT IS AT CHANGE 2 AND MUST GO UP TO CHANGE 4

RT 11-08-16

300

0.00



Crosstubes

Memo

0.00

Crosstubes

REMOVE SUPPORTS, CLAMPS AND ABRASION STRIPS

REWORK SUPPORTS D2891-1 AS PER LATEST DRAWING

(Per note 8 on page 1 of dwg D2891, Prep inner concave surface of support and apply 3M Scotch-Weld as per dwg. 24H of cure time.

DISCARD CLAMPS AND ABRASION STRIPS

RT 11-08-16

Pto →

DART Dart Aerospace Ltd. 1270 ABERDEEN ST. HAWKESBURY ONT CANADA K6A 1K7				TO APPROVAL # 09-69 TEL: 1-613-632-5200	
P/N	D407-667-105	Q=0	CHG002		
DESC.	Crosstube Fwd High	STC	SH01-5		
LOT	B38989	STC	SR01304NY		
MODEL	Bell 407	STC			
MADE IN CANADA				02729-1	


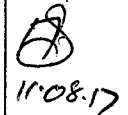
W/O: 72844		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector
11-08-16	300	Remove all paint from supports inside + out then apply a coat of 3M Scotch weld as per drawing D2891 QC 14	BT	11-08-16	1		
			BT	11-08-17	1		

Part No: D407-667-105 PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

W/O: 72844		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector
11-08-17	330	new hand ware used for cross tube assembly MS24920-20x4 B 117279x2 118236x2 3595 06B-395x4 B 70975	BT	11-08-17	1		 11.08.17

Part No: D407-667-105 PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 72844

Tuesday, August 16, 2011 10:45:46 AM



Page 3

Item ID: D407-667-105

Accept



Setup Start



Revision ID:

Item Name: Crosstube Fwd

Stop



Start Date: 8/16/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 8/16/2011 Req'd Qty: 1.00



Customer:

Reference: REWORK

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start



Stop



Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

340

QC5- Inspect part completeness to step on W/O

0.00



QC

Memo

0.00

Quality Control

① 1108.18

350

Identify as per dwg & Stock Location: _____

0.00



Packaging

Memo

0.00

Packaging

ID AND STOCK UNDER NEW BATCH NUMBER AND NEW CHANGE # 4

REPLACE WITH NEW PAPERWORK

11/8/18 BG 11-8-18

11/8/18

360

QC4- 100% Inspect kits for completeness

0.00



QC

Memo

0.00

Quality Control

Detroy S. Subling

④

Work Order ID 72844

Tuesday, August 16, 2011 10:45:46 AM

Page 4

Item ID: D407-667-105

Accept

Setup Start

Revision ID:

Item Name: Crosstube Fwd

Stop

Start Date: 8/16/2011 Start Qty: 1.00

Cust Item ID:

Required Date: 8/16/2011 Req'd Qty: 1.00

Customer:

Reference: REWORK

Approvals:

Process Plan: _____

Date: _____

Tooling: _____

Date: _____

Run Start

QC: _____

Date: _____

SPC (Y/N): _____

Date: _____

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

370

QC21- Final Inspection - Work Order Release

0.00



QC

Memo

0.00

Quality Control

11/8/19

11-08-19
①

NOTES:

1) MATERIAL: 17-4 PH STAINLESS STEEL, H900 OR H925 CONDITION
MIN UTS = 170 KSI (38 HRC)
(REF DART SPEC. D6104)

2) FINISH: NONE

3) TOLERANCES: PER DART QSI 018 (REF X.XXX = ± 0.010) UNLESS OTHERWISE NOTED



4) UNITS: INCHES UNLESS OTHERWISE NOTED

5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX



6) IDENTIFICATION: DART LOGO (PER DART SUPPLIED GRAPHIC) AND PART NUMBER IN THIS AREA WITH 0.125 HIGH LETTERING 0.010-0.020 DEEP, PER DART QSI 044 6.3.

7) WEIGHT: 0.38 lb

8) FOR THE ENTIRE INNER CONCAVE SURFACE:
ABRADE SURFACE WITH 400-GRIT SANDPAPER. REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY 0.03" TO 0.05" THICK LAYER OF 3M SCOTCH-WELD 2216 B/A ADHESIVE TO MATING SURFACE OF SUPPORT. ALLOW TO CURE FOR 24 HOURS.

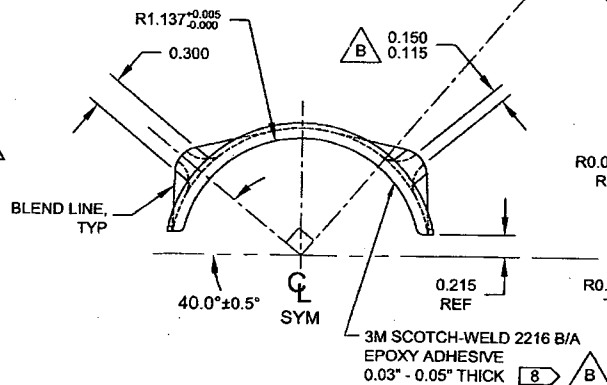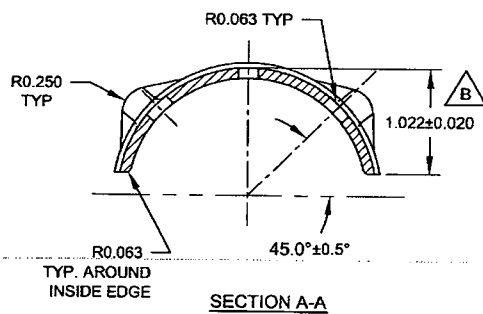

D2891-1 SUPPORT

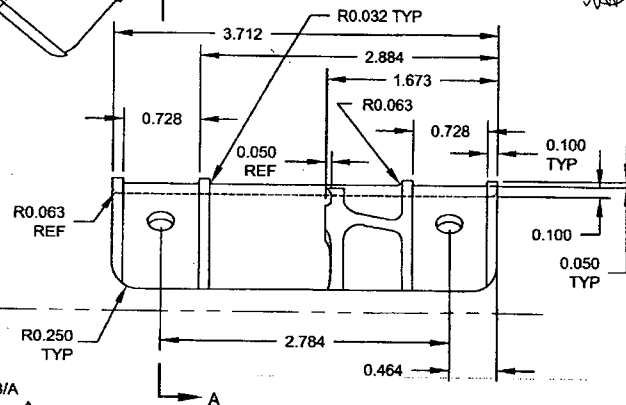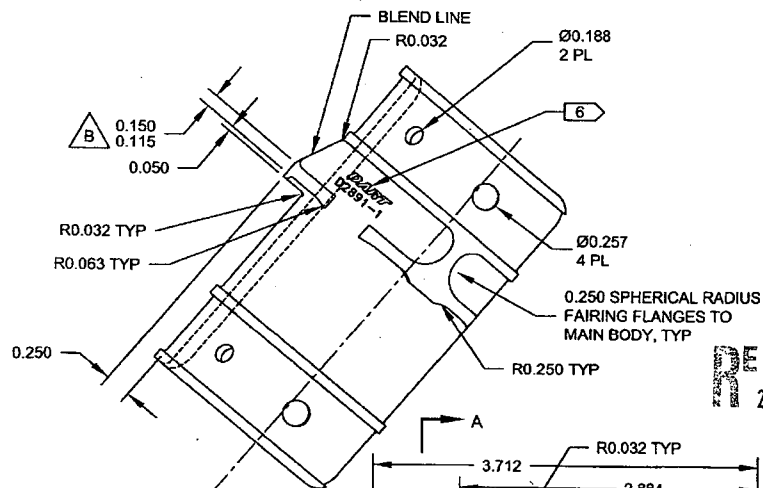

RELEASED
2011-07-28

B	RMV FINISH, ADD 3M 2216, ADD H925 MATL OPTION, UPDATE TOLERANCE (ZN D4-1, B4-1, B6-1)	CP	11.07.15
A	NEW ISSUE	CP	00.11.17
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	11.07.15		
DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA			
DRAWING NO. D2891		REV. B	
TITLE Ø2.250 SUPPORT		SHEET 1 OF 1	
DATE 11.07.15		SCALE NTS	

COPYRIGHT © 2000 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. NO PART OF THIS DOCUMENT IS TO BE REPRODUCED OR TRANSMITTED IN ANY FORM OR BY ANY MEANS, ELECTRONIC OR MECHANICAL, WITHOUT PERMISSION FROM DART AEROSPACE LTD.

DART SERVICE INSTRUCTION

TO AMEND INSTRUCTIONS FOR CONTINUOUS AIRWORTHINESS ICA-D206-667 Rev. 3 OR LATER

REF. CANADIAN STC: SH01-5

REF. FAA STC: SR01304NY

REF. EASA STC: EASA.IM.R.S.01179

PURPOSE:

The supports on the following crosstubes are now installed using Proseal instead of Magnobond:

D206-667-101 @ CHG 004

D206-667-103 @ CHG 005

D206-667-107 @ CHG 002

D206-667-201 @ CHG 004

D206-667-203 @ CHG 004

D206-667-207 @ CHG 002

D407-667-105 @ CHG 004

CHANGE:

For the crosstubes listed above, section 32.4 of ICA-D206-667 is amended as follows. Use Figures 32-4 to 32-8 of ICA-D206-667 for further reference. For crosstubes of an earlier change number, it is recommended that if the supports are removed, the supports should be reinstalled using the procedure listed below.

32.4 SUPPORT INSTALLATION

- 32.4.1 Locate the area on crosstube for installation of support (ref. Figures 32-4 to 32-8 of ICA-D206-667). For D206-667-101/-103/-107/-201 and D407-667-105 crosstubes, the outward face of the support tabs should be 13.08" (332mm) from the crosstube center. For D206-667-203/-207 crosstubes, the outward face of the support tabs should be 10.03" (255mm) from the crosstube center. Ensure paint finish of crosstube is intact; touch up as required per Chapter 5 (5.3.9) of ICA-D206-667.
- 32.4.2 If present, remove any paint/primer on bottom of supports. Abrade mating surfaces of support and crosstube with 400-grit sandpaper. Saturate a clean cloth with MEK or 4105S Wash'n'Wipe Degreaser or equivalent and wipe until there is no residue.
- 32.4.3 Ensure a layer of 3M Scotch-Weld 2216 B/A Epoxy Adhesive is on the bottom of the support. If required, either apply or touch-up support to have a 0.03" to 0.05" thick layer of adhesive over the entire mating surface. Allow supports to cure for 24 hours.
- 32.4.4 Abrade mating surfaces of support (after cure) and crosstube with 180-grit sandpaper. Saturate a clean cloth with MEK or 4105S Wash'n'Wipe Degreaser or equivalent and wipe until there is no residue.
- 32.4.5 Apply a 0.04" to 0.07" thick layer of Proseal 890 Class B or AMS-S-8802 Class B sealant underneath applicable support and install support.
- 32.4.6 Install the clamps opposite to crosstube support as shown in Figures 32-4 to 32-8 of ICA-D206-667. Install rubber cushions underneath each clamp around the bottom circumference of the crosstube up to the crosstube centerline. Torque clamps 80-100 in-lb (9.0-11.3 Nm). It is acceptable to use smaller or larger sized MS21920-XX clamps than those listed in ICA-D206-667, ensure that after torquing the clamps per this instruction, the nuts are in safety but not bottomed out.
- 32.4.7 Prior to installing crosstube on aircraft, allow supports to cure for 72 hours and recheck torque on clamps.

CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-O-01

 

APPROVED

BY: 
D. SHEPHERD (DE # 02)

DATE: 11.07.20

CERT. NO.: SH01-5

ISSUE NO.: 3

A	NEW ISSUE	CP	11.07.15
REV.	DESCRIPTION	BY	DATE
DESIGN	9P	DART AEROSPACE LTD	
DRAWN	9P	HAWKESBURY, ONTARIO, CANADA	
CHECKED	ASS	DRAWING NO.	REV. A
MFG. APPR.	N/A	DSI 9565	SHEET 1 OF 1
APPROVED		TITLE	SCALE
DE APPR.		SUPPORT INSTALLATION CHANGE	NTS
DATE	11.07.15	COPYRIGHT © 2011 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

Item	Qty -145	Part Number	Description
1	X	D407-667-145	CROSSTUBE ASSEMBLY (407 HIGH FWD)
2	1	D6010-115	CROSSTUBE
3	2	D2873-043	NUT PLATE
4	2	D2873-045	NUT PLATE
5	2	D2891-1	SUPPORT
6	4	D3595-063-395	RUBBER CUSHION
7	4	MS21920-20	CLAMP (OR MS21920-21)
8	14	MS20601AD4W10	RIVET (OR NAS9302B-4-10)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299- 947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6010-115
FINISHED LENGTH = 113.20±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D407-667-145" AND BATCH NUMBER ON
INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 17.8 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART WHERE INDICATED. BLEND OUT EDGE LONGITUDINALLY.
TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 6 PASSES. MAXIMUM TUBE FLATTENING DUE
TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2891-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER
QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-20 CLAMPS (OR -21) WITH D3595-063-395 RUBBER CUSHIONS TO SECURE
THE D2891-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMP MECHANISMS
ARE LOCATED ON CROSSTUBE SUPPORTS.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE
OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS
SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT
LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN
SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

DEO ATTACHED

ECW #11-615


11.07.26

UNDER REVIEW

RELEASED
08/11/12

C	REVISE GENERAL NOTES/PART LIST (ZN D7-1); REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS. D3595-063-395 WAS D2856-400-694 (ZN D6-2 & A5-2); REMOVED REF. 7 ADD TOLERANCES (ZN C6-3, C4-3, D2-3); RELOCATED FLAG #6 (ZN A8-3) PER NCR 210; MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	08.11.06
B	ADD HOLES AND NUT PLATES FOR COMPATABILITY WITH BHT/AA SKUDTUBES	PH	05.07.26
A	NEW ISSUE	CP	02.05.08
REV.	DESCRIPTION	BY	DATE
DESIGN	RF	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF	DRAWING NO.	REV. C
CHECKED	RF	D407-667-145	SHEET 1 OF 4
MFG. APPR.	RF	TITLE	SCALE
APPROVED	RF	CROSSTUBE ASSY (407 HIGH FWD)	NTS
DE APPR.	RF	COPYRIGHT © 2005 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	
DATE	08.11.06		

72844

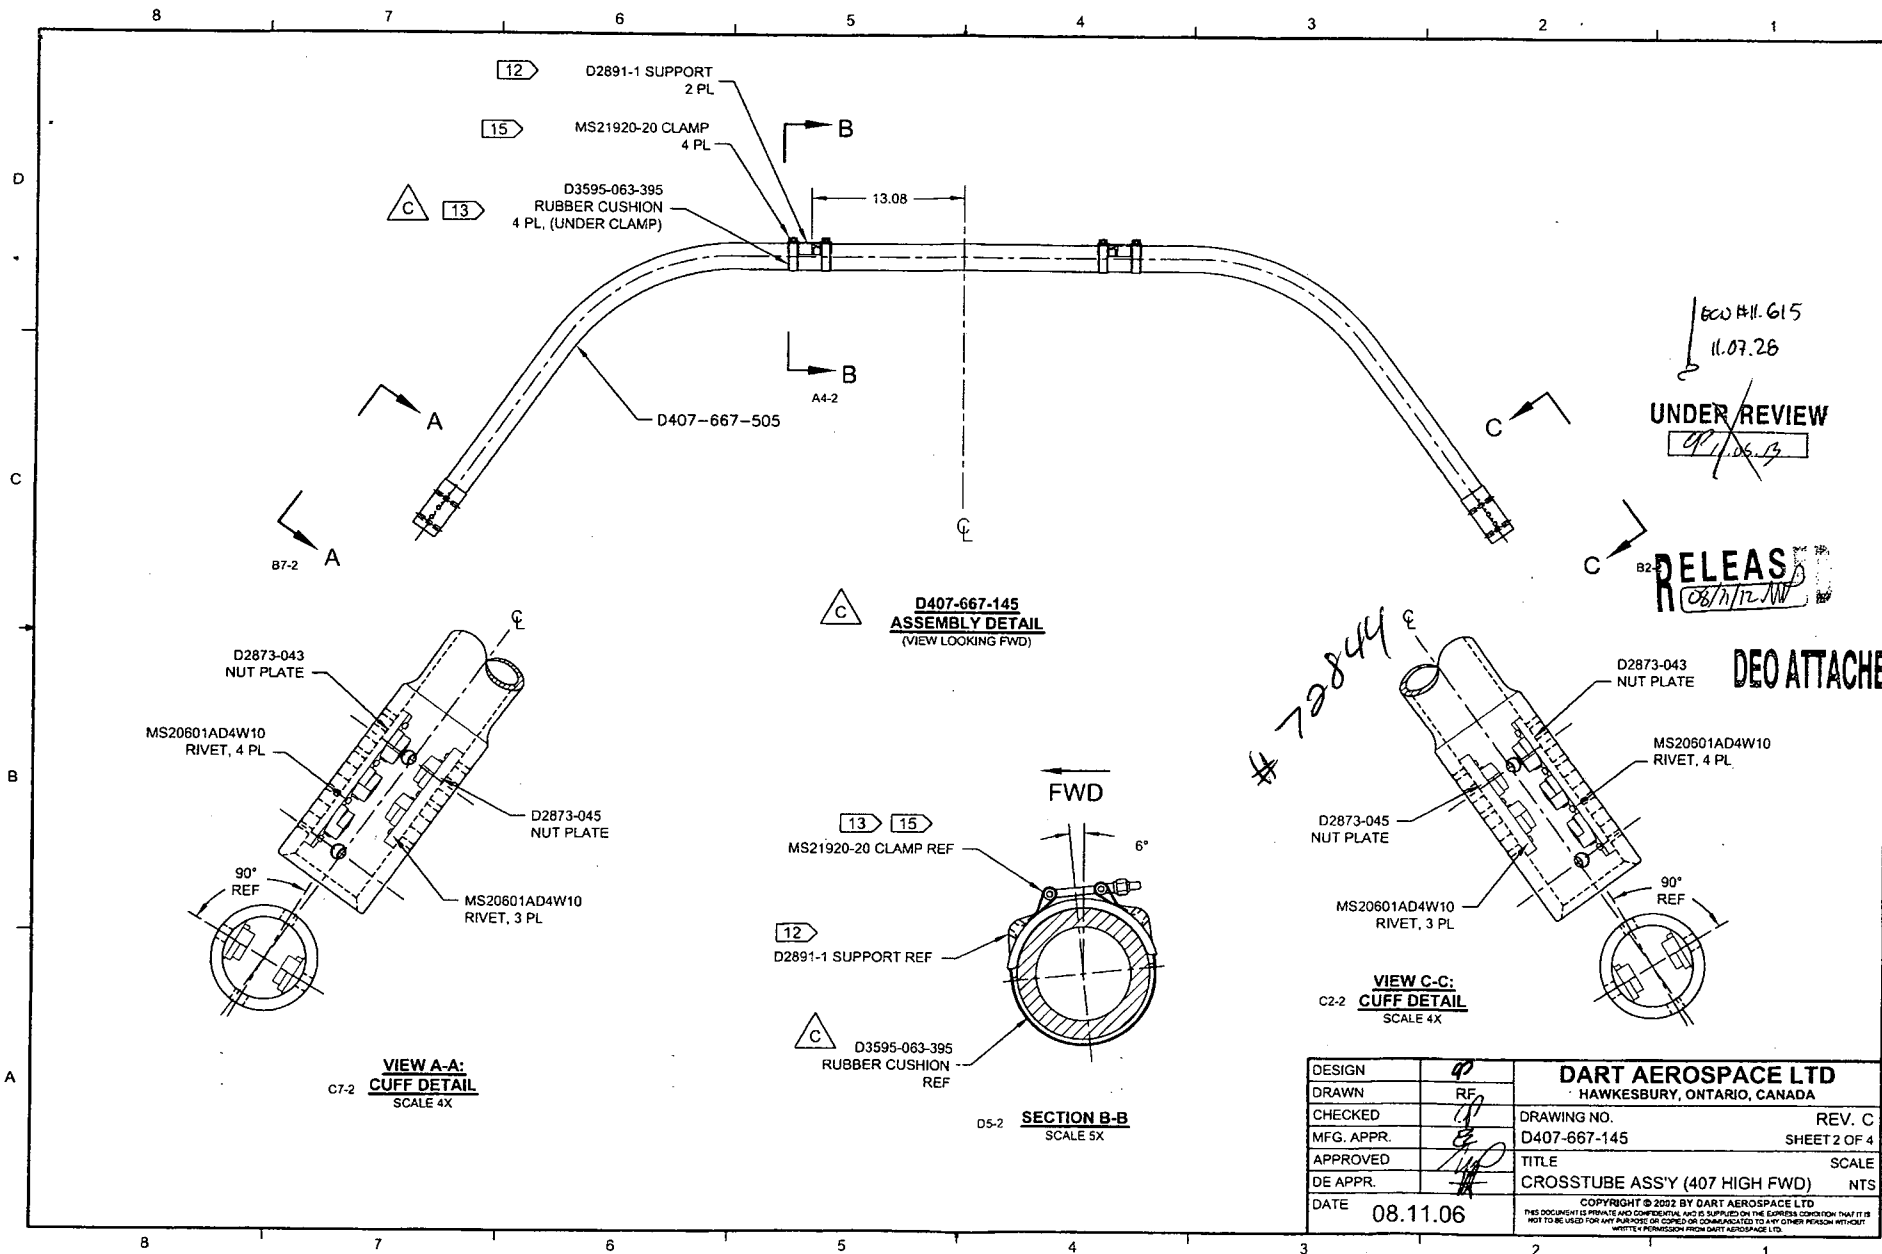

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

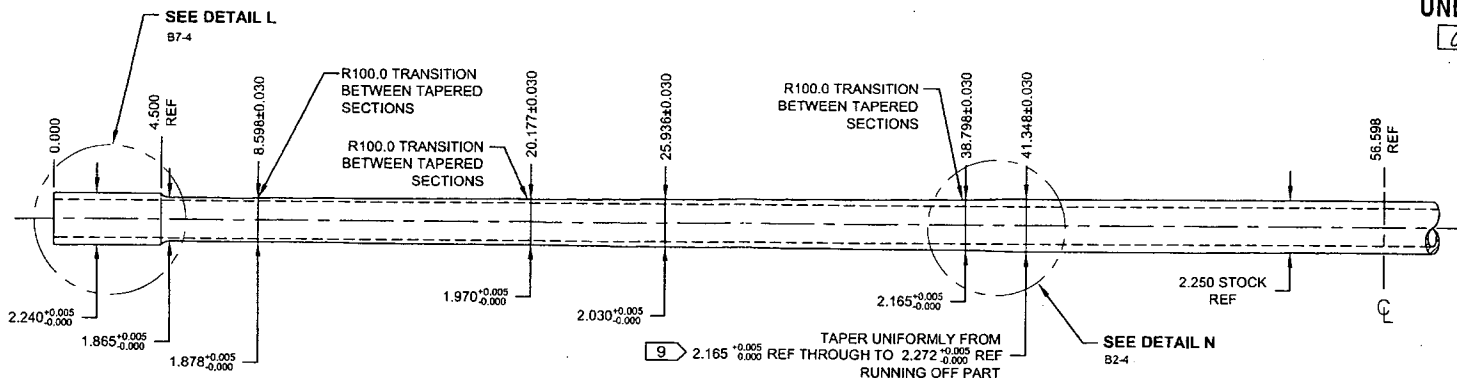


UNDER REVIEW

08/11/08
601 H.L. 615
11.07.26


C TURNING DETAIL

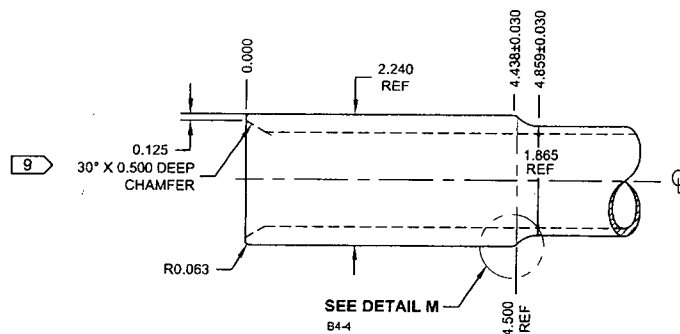

**DETAIL L:
CROSSTUBE CUFF**
NOT TO SCALE

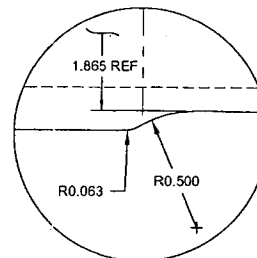

**DETAIL M:
CUFF TRANSITION**
NOT TO SCALE

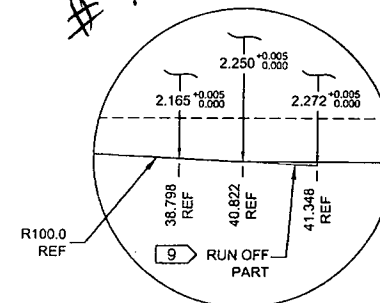

**DETAIL N:
TAPER RUN-OFF**
NOT TO SCALE

DEO ATTACHED

RELEASED
08/11/08

DESIGN	4	DART AEROSPACE LTD	
DRAWN	RE	HAWKESBURY, ONTARIO, CANADA	
CHECKED	4	DRAWING NO.	REV. C
MFG. APPR.	4	D407-667-145	SHEET 4 OF 4
APPROVED	4	TITLE	SCALE
DE APPR.	4	CROSSTUBE ASSY (407 HIGH FWD)	NTS
DATE	08.11.06	COPYRIGHT © 2002 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DRAWING NO. D407-667-145	TITLE CROSSTUBE ASS'Y (407 HIGH FWD)	REV. C	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D407-667-145-C-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>Q</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>AB</i>	APPROVED <i>WD</i>		DE APPR. <i>HA</i>		
DATE 11.07.15	DATE 11.07.22	DATE 11.07.22	DATE 11/07/22		DATE 11.07.21		

PURPOSE:

REPLACE MAGNOBOND WITH PROSEAL.

CHANGE:

IS:

Item	Qty -145	Part Number	Description
9	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

WAS:

9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	----------------	---

NOTE 12 & 15, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) TO INSTALL D2891-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.**

WAS:

- 12) INSTALL D2891-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

#72844
RELEASED
2011-07-28
WD

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries